



INCIDENT INVESTIGATION #195761



313 Grand Ave, Lead, SD

LOCATION DETAILS

Event Date: 08/25/2020 12:10 PM America/Denver

Right-of-Way: Private Land

AFFECTED FACILITY

Near Miss: No

Type of Operation Affected: Gas

Line Size and Type: 0.75" Plastic

Facility part of joint trench: No

Asphalt or concrete removed: No

Damage Surface Type and Depth: Dirt < 18"

Arrival Date and Time: 08/25/2020 03:31 PM America/Denver



Distance from Ped to Ped: 50ft

Dimensions of Asphalt or Concrete Removed:

Repairs Taking Place Upon Arrival? Yes

Who Performed Repairs: Utility Company

Contractor Representative: Alan Williams

Contractor Representative Phone Number: (605) 580-0413

Personnel On Site: Alan

Vehicles/Equipment Being Used For Repairs: Backhoe 2 trucks

Guards or Barricades On Site:

Facilities Replaced or Repaired: Repaired

Replacement Type: Temporary

Occurred During: Business Hours

Time Occurred:

DAMAGER

Company Name: Williams Services

Contact: Alan

Contact Phone: (605) 580-0413

Type of Work: Retaining wall

Damage Responder: Kenneth, Kauffman

UTILITY INFORMATION

Utility Company Name: Montana Dakota Utilities

Utility Contact Name: Bruce

Utility Contact Phone: (605) 645-1541

Utility Representative: Steve and Chris

Utility Rep Tech#:

Utility Rep. Present on Arrival: Yes

EXCAVATION INFORMATION

Excavator Type: Contractor

Excavation Equipment: Unkown/Other

Work Performed: Landscaping

Excavator downtime? Yes

Downtime hours: No

Downtime cost: No

NOTIFICATION AND LOCATING

One Call Center notified: No

Locator Type:

Work area white-lined: No

Ticket Number:

Date Located:

Located By: ZZ_No Locate Requested

INTERRUPTION AND RESTORATION

Event cause Interruption: Yes

Interruption hours:

Customers Affected (approx.): 1

ROOT CAUSE

Damage within described dig area: No

Damage within legal time of request limit: No

Marks destroyed by construction: No

Marks destroyed by weather: No

Whiskers or flags used: No

Offsets were used on hard surfaces: No

Line was on prints: No

At Fault: Excavator

Documentation Issue: No

Documentation Issue Comments:

Tolerance Zone: No

Marking Standards: No

Marking Standards Comments:

Locate Requested: No

Damage with Tolerance Zone: No

No Locates on Facility: Yes

Damage Exposed Facility: No

COMMENTS

Assessment Comments: Bruce with MDU Called me at 12 58 To inform me of gas blowing at 313 Grand Avenue in lead South Dakota contractor/home owner did not have a ticket he did call 911 and 811 and MDU. Contractor is preparing to put in a retaining wall he was moving rocks out of the way and drop the rock on the line. MDU Stopped the leak and will repair the line At a later date they will need to make the line deeper for the retaining wall 3/4 inch plastic service was damaged

NEW INCIDENT PHOTOS



Date: 08/25/2020 03:31 PM
America/Denver

Latitude: 44.348211

Longitude: -103.769861

Heading: 347 degrees




Date: 08/25/2020 03:31 PM
America/Denver

Latitude: 44.348231

Longitude: -103.769832

Heading: 322 degrees

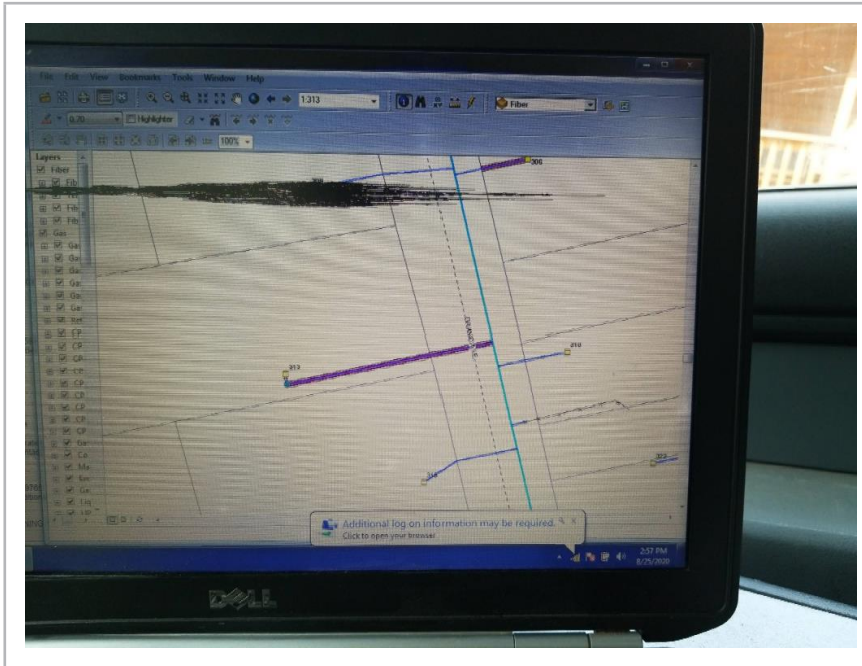

Date: 08/25/2020 03:31 PM
America/Denver

Latitude: 44.348486

Longitude: -103.769793

Heading: 134 degrees



Date: 08/25/2020 03:31 PM
America/Denver

Latitude: 44.348351

Longitude: -103.769829

Heading: 343 degrees